

DAM NUMBER	DAM NAME	Hazard	COUNTY	ASSESSMENT DATE	CONDITION	CREST	PRIMARY SPILLWAY	TREE DAMAGE	BREACH STATUS	EMERGENCY REPAIRS	RAINFALL	PIPING BOILS	EROSION	FULL INSPECTION REQUIRED	AUX SPILLWAY CONDITION	EROSION DESCRIPTION	COMMENTS	OWNER PRESENT
D0513	BAXLEY 501 POND DAM	Class 2 - Significant	Marion	9/17/18	Breached	Overtop - Erosion	Full Flow	No Tree Damage	---	No	> 2"	None	> 12" - Failure Pot.	---	Flow-Erosion	Cutting through dam now. Significant erosion along barrel at spillway. Cut 3 ft below crest. 2-3ft left to bottom.	Dam in process of failure. Water level 3ft below top of dam. 2 - 3 ft left to breach bottom. Damage along barrel at primary. Scouring on crest but not major erosion except at breach and spillway.	Yes
D0513	BAXLEY 501 POND DAM	Class 2 - Significant	Marion	9/18/18	Breached	Freeboard > 1 ft.	Full Flow	Uprooted Critical	Logs Accumulating	No	> 2"	None	> 12" Deep	Y	Flow-Erosion	Breach in center of dam along with significant erosion at primary and aux spillway. Trees leaning and/or uprooted at several locations.	Center breach in dam and significant erosion in and around spillways...and adjacent to road. See photos and erosion description. Supplemental photos of road downstream have been added	No
D0513	BAXLEY 501 POND DAM	Class 2 - Significant	Marion	9/19/18	Breached	Overtop - Erosion	Full Flow	Uprooted Critical	Holding Some Water	No	> 2"	None	> 12" Deep	Y	No Flow	Erosion of slopes, crest, and auxiliary spillway.	No debris in primary spillway. Some debris at breach but water is still flowing. Auxiliary spillway no longer active.	No
D0848	MCCOLL POND DAM	Class 3 - Low	Dillon	9/19/18	Breached	Freeboard > 1 ft.	---	Uprooted Noncritical	Holding Some Water	No	> 2"	None	> 12" Deep	N	No Flow	Side slopes of breach may have widened from storm. Uprooted tree left void on right side of breach opening.	Freeboard approximately 8 ft.	No
D1824	CRAWFORD POND DAM	Class 3 - Low	Chesterfield	9/18/18	Breached	Overtop - Erosion	No Flow	---	No Water	---	> 2"	---	---	---	---	---	The dam is fully breached, there was a minor flow. The breach must have happened within the last few days.	---
D3188	LAKEWIND DAM	Class 2 - Significant	Chesterfield	9/17/18	Breached	Overtop - Erosion	---	Uprooted Critical	No Water	No	> 2"	None	> 12" - Failure Pot.	Y	---	Dam failure has occurred. Owner contacted emergency services last night when it failed at approximately 6:00 PM. Breach is approximately 30' wide and occurred at approximately the center of dam. Erosion is all the way to creek/tributary level.	Owner stated he had a meeting with Rick Caldwell setup for Oct 3 to discuss the dam. Owner's driveway ran across crest of dam so they currently have no way to leave property.	Yes
D3430	McMEEKIN POND DAM	Class 3 - Low	Marlboro	9/17/18	Breached	Freeboard > 1 ft.	Full Flow	No Tree Damage	Holding Some Water	No	> 2"	None	> 12" Deep	Y	No Flow	Full breach next to primary spillway. Water still in reservoir. Large amount of flow through the breach.	Full breach. Water still flowing through	No
D3441	MCLAURINS MILLPOND DAM	Class 2 - Significant	Marlboro	9/17/18	Breached	Freeboard > 1 ft.	Partial Flow	---	Holding Some Water	No	---	---	> 12" Deep	Y	---	---	Breached	No
D3450	DAVIDS MILLPOND DAM	Class 2 - Significant	Marlboro	9/18/18	Breached	Overtop - Erosion	---	No Tree Damage	---	---	> 2"	---	---	Y	No Flow	---	Full breach of dam at former spillway. Bridge 100 feet below is collapsed and the road is barricaded	---
D3453	COVINGTON MILLPOND DAM	Class 3 - Low	Marlboro	9/18/18	Breached	---	No Flow	---	Holding Some Water	---	---	---	---	Y	---	---	Overtopping on the earthen section of the dam is where the breach occurred. 3 primary spillways intact. Local citizen on site stated dam failed last year at the same location. Road overtopped with extensive erosion along the shoulder. Asphalt is intact	---
D3530	LAKE DARPO DAM	Class 3 - Low	Darlington	9/17/18	Breached	Overtop - Erosion	No Flow	Uprooted Critical	Holding Some Water	No	> 2"	None	> 12" Deep	Y	---	Breached	Breached. Approximately 9 ft freeboard. Addendum: No damage noticed just debris. US 15 downstream of D3530	No
D3532	JORDAN POND DAM	Class 2 - Significant	Darlington	9/18/18	Breached	Freeboard > 1 ft.	No Flow	Uprooted Critical	Holding Some Water	No	> 2"	None	> 12" Deep	Y	Flow-Erosion	Runaround breached.	Breached at what appears to be aux runaround with trees uprooted. Pond only holding a few feet of water. 16' freeboard to crest.	No
D3539	SPRING LAKE DAM	Class 3 - Low	Darlington	9/17/18	Breached	Overtop - Erosion	No Flow	Uprooted Critical	Holding Some Water	No	> 2"	None	> 12" Deep	Y	Flow-Erosion	Breached, crest eroded bare, second auxiliary spillway eroded.	Dam breached through auxiliary spillway. Approximately 14 ft of freeboard. Addendum: Society hill rd downstream of D3539	Yes