



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 22, 2001

Division of Fire & Life Safety
Attn: Mr. Lloyd Mitchell
141 Monticello Trail
Columbia, SC 29203

RE: Reinspection of Dam D-4455, SC Fire Academy Dam, Richland County

Dear Mr. Mitchell:

This office performed a routine inspection of the SC Fire Academy Dam on Thursday, June 21, 2001. The dam appears to be in good condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

-Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Thursday, June 21, 2001

Dam D-4455, SC Fire Academy Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

None

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*None

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*None

Emergency Action Plan Updated

Yes _____ No



Signature of Person Completing Form

DAM SAFETY INSPECTION FORM

Inspector Scott Simons

Date 12-14-10 Time 12:30

Dam# 01718

Class 2

Name of Dam Brown Dam

Owner _____

Crest:

Erosion yes () no () Description:

Visibility good () fair () poor ()

Description of vegetation:

Other:

Upstream slope:

Erosion yes () no () Description:

Visibility good () fair () poor ()

Description of vegetation:

Other:

Downstream slope:

Erosion yes () no () Description:

Visibility good () fair () poor ()

Description of vegetation:

Other:

Emergency Spillway:

Erosion yes () no () Description:

Obstructions (logs, vegetation, etc.) yes () no ()

Other:

Principal Spillway & Outlet Channel/Basin (Deterioration, blockage, trash rack, etc.)

Additional Comments:

Riser removed and pipes/culverts installed so no water is impounded as a reservoir anymore. A plan was approved by Central office. Letter of approval included in folder.



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

December 5, 2008

Mr. Ray Bickley
106 Whisperwood Dr.
Lexington, SC 29072

RE: Re-inspection of Dam D-1714, Ray Bickley Dam,
Lexington County

Dear Mr. Bickley:


This office performed a routine inspection of the Ray Bickley Dam on Friday December 5, 2008. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

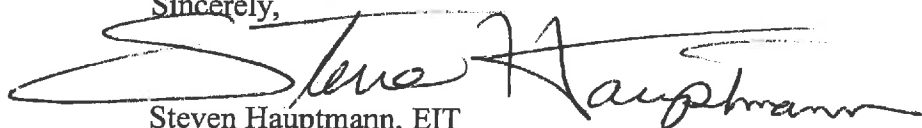
Steven Hauptmann, EIT
District Engineer Associate
Region 3 EQC-Columbia

Enclosures

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 3

Serving Chester, Fairfield, Lancaster, Lexington, Newberry, Richland and York Counties

Columbia EQC Office • PO Box 156 • State Park, SC 29147 • Phone: (803) 896-0620 • Fax: (803) 896-0617 • www.scdhec.gov

INSPECTION REPORT

Date December 5, 2008

Dam D-1714, Ray Bickley Dam, Lexington County

Representatives of SCDHEC Present:

Steven Hauptmann

Representatives of Owner Present:

none

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, etc.) and small trees (less than 6 inches in diameter) should be removed from dam. It is not possible to make passes along the down slope due to the over growth of brush, saplings and briars. The dam should be cleared and maintained so that a complete inspection can be preformed..

*There is some erosion at the spillway outlet and immediately surrounding areas. Continue to monitor this area as it is becoming worse and eventually actions to support the spillway piping at the outlet structure will need to be considered

*There is some slowly flowing water at the spillway outlet erosion at the area to the south side of the spillway outlet. Although the ground above was not wet, it had been lightly raining approximately 10hrs prior to my inspection. The source of this flowing water could not be verified at this time. This condition should be monitored for changes.

List of previously noted items still uncorrected and dates previously noted:

*Erosion at spillway outlet (12/94, 12/97, 7/04)


*Trash rack (12/97)

* All vegetation (brush, weeds, etc.) and small trees (less than 6 inches in diameter) have been removed from dam. (7/04, 12/08)

Emergency Action Plan Updated

Yes x No _____

Signature of Person Completing Report

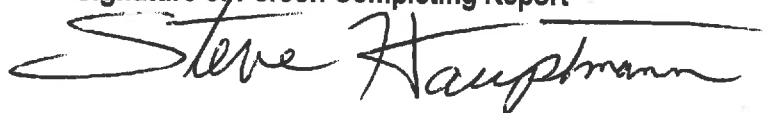

**NOTIFICATION OF OWNERSHIP CHANGE
S.C. REGULATED DAM**

Date _____

The ownership of Dam D _____, _____ in
(Name of Dam)

_____ County has changed. The new owner(s) are:

Owner 1* _____

Address _____

City, State, Zip _____

Telephone Number _____

Owner 2* _____
(if applicable)

Address _____

City, State, Zip _____

Telephone Number _____

Additional Owner* _____
(if applicable)

Address _____

City, State, Zip _____

Telephone Number _____

*If owner is a corporation, give name of principal contact person:

(Previous Owner's Signature)

Previous Owner's Name

Previous Owners Address

Mail Above Notification To: S.C. Department of Health and Environmental Control
Dams and Reservoirs Safety
2600 Bull Street
Columbia, SC 29201

NOTE: Failure to notify the S.C. Department of Health and Environmental Control within 30 days of ownership transfer can result in a fine of \$100 - \$1000.

DHEC 2605(6/94)

INSPECTION REPORT

Date December 7, 2010

Dam D-0986, Silver Lake Dam, Lexington County

Representatives of SCDHEC Present:

Scott Simons

Representatives of Owner Present:

Frank Green.

Others Present:

None.

Items requiring correction/checking:

1. Weeds, brush and all trees less than six (6) inches in diameter should be cut/removed from around the outlet structure, crest, downstream and upstream slope on a regular basis (recommended minimum annually).
2. Some erosion is occurring above the primary spillway outlet pipe. Area should be monitored and backfilled with appropriate soil and stabilized/grassed.
3. Outlet end of the emergency spillway pipe appears to be partially blocked/clogged. Evaluations and repairs/clearing should be made as soon as possible.

List of previously noted items still uncorrected and dates previously noted:

None.

General Recommendations:

1. Any tree larger than 6 inches in diameter that is removed should also have their stump removed. The excavation shall be backfilled with appropriate soil, compacted and stabilized.

Emergency Action Plan Updated Yes

Signature of Person Completing Form

Scott L. Simons



GDS
Stueh

C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

November 23, 2010

William Kerr
1110 Woodtrail Dr.
Gaston, SC 29053

Richard Welty
1234 Woodtrail Dr.
Gaston, SC 29053

Re: Inspection of D-0976, Roy Jeffcoat Dam, Lexington County

Dear Mr. Kerr and Mr. Welty:

According to property records it appears you are co-owners of the referenced pond dam parcel #'s 010000-04-003 & 010000-04-179. This dam is due for inspection under the provisions of the South Carolina Dams and Reservoirs Safety Act.

We have tentatively selected December 7, 2010, as the day we will be inspecting the dam. We plan to arrive at the dam at approximately 10:15 AM, and we request that you have someone available to accompany us. During this time, it will be necessary to update the names and telephone numbers on the Emergency Notification Plans for the dam. Also, if you have not already done so, please have any thick vegetation cut from the slopes of the dam so that we can do a complete inspection.

If you cannot have someone meet us for the inspection, please make sure any entrance gates are unlocked and call me as soon as possible at (803) 641-7670 to give us the necessary information for the Emergency Notification Plans. We look forward to meeting with you.

Sincerely,

Scott L. Simons
Dam Safety Program
Region 5 Aiken - EQC

RECEIVED

NOV 29 2010

REGION 3
EQC - COLUMBIA

cc: Steve Bradley, PE, Bureau of Water – SCDHEC
Steve Hauptmann, Region 3 Columbia - EQC

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 5

Serving Aiken, Allendale, Bamberg, Barnwell, Calhoun and Orangeburg Counties
Aiken EQC Office • 206 Beaufort Street NE • Aiken, SC 29801 • Phone: (803) 641-7670 • Fax: (803) 641-7675 • www.scdhec.gov

INSPECTION REPORT

Date December 7, 2010

Dam D-0976, Roy Jeffcoat Dam, Lexington County

Representatives of SCDHEC Present:

Scott Simons

Representatives of Owner Present:

William Kerr and Richard Welty.

Others Present:

None.

Items requiring correction/checking:

1. The primary spillway has failed and is no longer functioning and should be repaired. Prior to making repairs contact Steve Bradley (803)898-4027 concerning any permitting requirements.
2. During the inspection it was discussed the possibility due to downstream conditions changing the dam may now be a Class III dam. Contact Steve Hauptmann (803)896-0620, to discuss possible evaluation of a classification change.
3. Outlet end of the emergency spillway pipe appears to be blocked/clogged. Evaluations and repairs should be made as necessary.

List of previously noted items still uncorrected and dates previously noted:

None.

General Recommendations:

1. Weeds, brush and all trees less than six (6) inches in diameter should be cut/removed from around the outlet structure, crest, downstream and upstream slope on a regular basis (recommended minimum annually).
2. Any tree larger than 6 inches in diameter that is removed should also have their stump removed. The excavation shall be backfilled with appropriate soil, compacted and stabilized.

Emergency Action Plan Updated Yes

Signature of Person Completing Form

Scott L. Simons



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 22, 2001

Halcyon, Inc.
Attn: Mr. David Peterson
9600 Two Notch Rd.
Suite 5
Columbia, SC 29223

RE: Reinspection of Dam D-4435, Chestnut Hill Dam, Richland County

Dear Mr. Peterson:

This office performed a routine inspection of the Chestnut Hill Dam on Thursday, June 21, 2001. The dam appears to be in good condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Thursday, June 21, 2001

Dam D-4435, Chestnut Hill Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

None

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*None

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*None

Emergency Action Plan Updated

Yes _____ No



Signature of Person Completing Form

DHEC 2604 (6/94)

INSPECTION REPORT

Date December 14, 2010

Dam D-0965, Lake Pauline Dam, Lexington County

Representatives of SCDHEC Present:
Scott Simons

Representatives of Owner Present:
Arno Froese & Simon Froese.

Others Present:
None.

Items requiring correction/checking:

1. A significant amount of brush, trees and vegetation prevent a complete/thorough inspection. Weeds, brush and all trees less than six (6) inches in diameter should be cut/removed from around the outlet structure, crest, downstream and upstream slope on a regular basis (recommended minimum annually).
2. During the inspection it was noted that it appears significant wind wave erosion is occurring in some areas along the waterline on the upstream side and could be in conjunction with potential aquatic animal activity. One area of particular concern is near and on the eastern side of the old primary spillway location. A large tree's roots are being considerably undermined by wind wave action and therefore an increased potential to fall, likely causing detrimental damage to the dams structural integrity. Entire upstream slope should be evaluated and necessary repairs/stabilization conducted as soon as possible.


List of previously noted items still uncorrected and dates previously noted:
None.

General Recommendations:

1. Any tree larger than 6 inches in diameter that is removed should also have their stump removed. The excavation shall be backfilled with appropriate soil, compacted and stabilized.

Emergency Action Plan Updated Yes

Signature of Person Completing Form

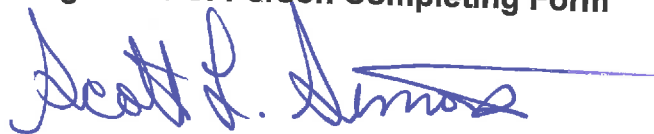



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5
State Park, SC 29147
(803) 935-7015 Fax (803) 935-6724

May 30, 2000

Kennecott Ridgeway Mining Company
Attn: Steve Jarvis
Rt. 2 Box 106
Ridgeway, SC 29130

RE: Reinspection of Dam D-4394, Process Solution Pond Dam, Fairfield County

Dear Mr. Jarvis:


On Friday, May 26, 2000, I conducted a routine reinspection of the above referenced dam. I am enclosing a copy of the inspection report on the dam. Any deficiencies are listed on the inspection report.

I have verified the telephone numbers on the Emergency Notification Plan and a copy is enclosed for your use. Should the dam experience difficulty, you should contact all of the numbers on the plan. The agencies listed on the plan can provide assistance in blocking roads and doing other things that need to be done in the event of an emergency.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us (SC DHEC) within thirty (30) days after transferring title or control of a dam to someone else. The notification must include the name, address and telephone number of the new owner. I am enclosing a blank form for your use in notifying us should control of your dam be transferred.

You will be notified when the next reinspection of this dam is scheduled.

Sincerely,


Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date May 26, 2000

Dam D-4394, Process Solution Pond Dam

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: Steve Jarvis

Others Present: _____

List of noted deficiencies or items requiring correction/checking:

None

NOTE: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

Emergency Action Plan Updated Yes x No _____



Signature of Person Completing Form

DHEC 2604 (6/94)



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5

State Park, SC 29147

(803) 935-7015 Fax (803) 935-6724

May 30, 2000

Kennecott Ridgeway Mining Company

Attn: Steve Jarvis

Rt. 2 Box 106

Ridgeway, SC 29130

Roy Duckett - 337-3276

RE: Reinspection of Dam D-4140, Tailings Impoundment Dam, Fairfield County

Dear Mr. Jarvis:

On Friday, May 26, 2000, I conducted a routine reinspection of the above referenced dam. I am enclosing a copy of the inspection report on the dam. Any deficiencies are listed on the inspection report.

I have verified the telephone numbers on the Emergency Notification Plan and a copy is enclosed for your use. Should the dam experience difficulty, you should contact all of the numbers on the plan. The agencies listed on the plan can provide assistance in blocking roads and doing other things that need to be done in the event of an emergency.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us (SC DHEC) within thirty (30) days after transferring title or control of a dam to someone else. The notification must include the name, address and telephone number of the new owner. I am enclosing a blank form for your use in notifying us should control of your dam be transferred.

You will be notified when the next reinspection of this dam is scheduled.

Sincerely,

Kendrick R. Chiles

District Engineer Associate

Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date May 26, 2000

Dam D-4140, Tailings Impoundment Dam

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: Steve Jarvis

Others Present: _____


List of noted deficiencies or items requiring correction/checking:

None

NOTE: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

Emergency Action Plan Updated Yes x No _____

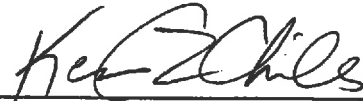

Signature of Person Completing Form

INSPECTION REPORT

Date December 14, 2010

Dam D-0953, Crystal Lake Dam, Lexington County

Representatives of SCDHEC Present:

Scott Simons

Representatives of Owner Present:

Clayton Macauley

Neill Macauley.

Others Present:

None.

Items requiring correction/checking:

1. Sinkhole noted adjacent to the primary spillway south wing wall near the crest. Appears a crack in the wing wall may be allowing rainwater to transport soil and form the sinkhole/void. This area should be evaluated as soon as possible and backfilled/repared and stabilized as necessary. Owners are aware and are monitoring deterioration until repairs are made.
2. Several cracks were noted in the downstream portion of the primary spillway, some with minor seepage occurring. I beam braces/supports have been installed to support the concrete wing walls/structure. Owner is aware and has monitored and will continue to monitor and make repairs as necessary. Cracks/seeps appear to have been stable for years. If increased or muddy seepage and/or further deterioration is noticed, Notify Region 3 Columbia-EQC.

List of previously noted items still uncorrected and dates previously noted:


None.

General Recommendations:

1. Weeds, brush and all trees less than six (6) inches in diameter should be cut/removed from around the outlet structure, crest, downstream and upstream slope on a regular basis (recommended minimum annually).
2. Any tree larger than 6 inches in diameter that is removed should also have their stump removed. The excavation shall be backfilled with appropriate soil, compacted and stabilized.

Emergency Action Plan Updated Yes

Signature of Person Completing Form

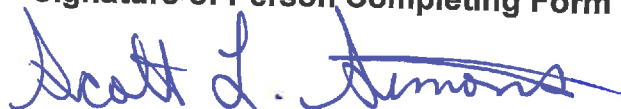



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5

State Park, SC 29147

(803) 896-0620 Fax (803) 896-0617

June 22, 2001

Mr. Steve Friedland
225 North Woodlake Dr.
Columbia, SC 29223

RE: Reinspection of Dam D-4083, Woodlake Dam, Richland County

Dear Mr. Friedland:

This office performed a routine inspection of the Woodlake Dam on Tuesday, June 19, 2001. The dam appears to be in fair condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles

District Engineer Associate

Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Tuesday, June 19, 2001

Dam D-4083, Woodlake Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: None

Others Present: None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*The above was noted in 06/98

Emergency Action Plan Updated

Yes _____ No



Signature of Person Completing Form



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

November 24, 2010

Mr. Edward Irwin
346 Muddy Springs Rd
Lexington, SC 29073

Re: Inspection of D-0953, Francis & Bill Irwin Dam, Lexington County

Dear Mr. Irwin:

Your dam is due for inspection under the provisions of the South Carolina Dams and Reservoirs Safety Act.

We have tentatively selected December 14, 2010, as the day we will be inspecting the dam. We plan to arrive at the dam at approximately 9:00 AM, and we request that you have someone available to accompany us. During this time, it will be necessary to update the names and telephone numbers on the Emergency Notification Plans for the dams. Also, if you have not already done so, please have any thick vegetation cut from the slopes of the dam so that we can do a complete inspection.

If you cannot have someone meet us for the inspection, please make sure any entrance gates are unlocked and call me as soon as possible at (803) 641-7670 to give us the necessary information for the Emergency Notification Plans. We look forward to meeting with you.

Sincerely,

Scott L. Simons
Dam Safety Program
Region 5 Aiken - EQC

RECEIVED

DEC 07 2010

**REGION 3
EOC - COLUMBIA**

cc: Steve Bradley, PE, Bureau of Water – SCDHEC
Steve Hauptmann, Region 3 Columbia - EQC

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 5

Serving Aiken, Allendale, Bamberg, Barnwell, Calhoun and Orangeburg Counties
Aiken EQC Office • 206 Beaufort Street NE • Aiken, SC 29801 • Phone: (803) 641-7670 • Fax: (803) 641-7675 • www.scdhec.gov

INSPECTION REPORT

Date December 14, 2010

Dam D-0953, Francis & Bill Irwin Dam, Lexington County

Representatives of SCDHEC Present:

Scott Simons

Representatives of Owner Present:

Bill Irwin.

Others Present:

None.

Items requiring correction/checking:

1. Weeds, brush and all trees less than six (6) inches in diameter should be cut/removed from around the outlet structure and from the upstream & downstream slope.
2. Monitor depression on the downstream slope of the western end. Repair stabilize as necessary .

List of previously noted items still uncorrected and dates previously noted:

Excess vegetation, 11/95, 6/00, 2004.

General Recommendations:

1. Weeds, brush and all trees less than six (6) inches in diameter should be cut/removed from around the outlet structure, crest, downstream and upstream slope on a regular basis (recommended minimum annually).
2. Any tree larger than 6 inches in diameter that is removed should also have their stump removed. The excavation shall be backfilled with appropriate soil, compacted and stabilized.

Note:

Dam is currently impounding a minimal amount of water. Water level is currently lowered to help facilitate in the degradation of potential hazardous chemicals released from off site/upstream to the pond. Boards will need to be replaced on the spillway before the pond is returned to full pool. **Region 3 Columbia – EQC should be notified prior to refilling the pond.**

Emergency Action Plan Updated Yes

Signature of Person Completing Form



MEMORANDUM

To: File

From: Kendrick R. Chiles

Subject: D-4021, Bouknight Pond Dam

Date: May 31, 2000

Unable to locate owner.

INSPECTION REPORT

Date May 31, 2000

Dam D-4021, Bouknight Pond Dam

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: Unable to locate owner

Others Present: _____

List of noted deficiencies or items requiring correction/checking:

* All vegetation (brush and weeds), all dead trees and limbs, and small trees (less than 6" in diameter) should be cut and removed from the dam.

* Erosion is occurring on the top of the dam.

NOTE: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

The above * were previously noted in June 1997

Emergency Action Plan Updated Yes _____ No x

Signature of Person Completing Form

DHEC 2604 (6/94)

MEMORANDUM

November 16, 2004

To: File

From: Kendrick R. Chiles *KRC*

Subject: D-0577, Adams Pond Dam

Unable to locate owner, but inspection was performed.

INSPECTION REPORT

Date November 16, 2004

Dam D-0577, Adams Pond Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present:

Others Present:

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

* Area around spillway should be cleared of brush and vegetation.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

Emergency Action Plan Updated

Yes _____ No


Signature of Person Completing Form

DHEC 2604 (6/94)



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 27, 2003

Elliott Mayer
3243 Belfast Rd.
Newberry, SC 29108

RE: Reinspection of Dam D-1469, Baker Pond Dam 2, Newberry County

Dear Mr. Mayer:

This office performed a routine inspection of the Baker Pond Dam 1 on June 19, 2003. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Natalie Loquist
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-1469, Baker Pond Dam 2, Newberry County

Representatives of SCDHEC Present:

Natalie Loquist

Representatives of Owner Present:

Elliott Mayer

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

* The backslope of the dam had been cleared and was in good condition. There were some areas on the backslope of the dam that need to be stabilized to prevent any erosion. The upstream side of the dam had not been cleared and a complete inspection was not able to be done due to heavy vegetation. This area needs to be cleared.

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

*There were several tree branches in the spillway. These need to be removed and a trashrack would be recommended to prevent any trash, branches, leaves, etc. from getting in the spillway.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*The brush and small trees (less than 6" in diameter) should be removed from the dam. (10/93, 06/97)

Emergency Action Plan Updated

Yes No

Natalie Loquist

Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 27, 2003

Elliott Mayer
3243 Belfast Rd.
Newberry, SC 29108

RE: Reinspection of Dam D-1468, Baker Pond Dam 1, Newberry County

Dear Mr. Mayer:

This office performed a routine inspection of the Baker Pond Dam 1 on June 19, 2003. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Natalie Loquist
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-1468, Baker Pond Dam 1, Newberry County

Representatives of SCDHEC Present:

Natalie Loquist

Representatives of Owner Present:

Elliott Mayer

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*The dam appeared to be in better condition than the previous inspection. The scrubs and brush should be removed from the dam while they are small. A complete inspection of this dam was not able to be completed because of thick vegetation on the dam. No areas of severe erosion were noted.

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*The brush and small trees (less than 6" in diameter) should be removed from the dam. (10/93, 07/97)

Emergency Action Plan Updated

Yes No


Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 20, 2003

Woodcreek Lake HOA
Attn: William C. Cooper
1713-B Woodcreek Farms Rd
Elgin SC 29045

RE: Reinspection of Dam D-0575, Woodcreek Lake Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on Thursday, June 19, 2003. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-0575, Woodcreek Lake Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

William C. Cooper, P.E.

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.


List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated

Yes No

Signature of Person Completing Form

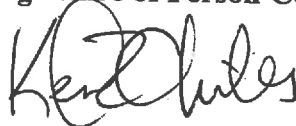



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

March 26, 2010

Bill Krecker
741 W.W. Lowman Rd.
Batesburg, SC 29066

Revised 11/22/10

RE: Reinspection of Dam D-0933, J.W. Corley Pond Dam, Lexington County

Dear Mr. Krecker:

This office performed a routine inspection of the Bill Krecker Pond Dam (formerly J.W. Corley Pond Dam) on *March 26, 2010*. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620 or hauptmse@dhec.sc.gov

Sincerely,

Steve Hauptmann, EIT
District Engineer Associate
Region 3 EQC- Columbia

Enclosures

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 3

Serving Chester, Fairfield, Lancaster, Lexington, Newberry, Richland and York Counties

Columbia EQC Office • PO Box 156 • State Park, SC 29147 • Phone: (803) 896-0620 • Fax: (803) 896-0617 • www.scdhec.gov



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

March 26, 2010

Bill Krecker
741 W.W. Lowman Rd.
Batesburg, SC 29066

RE: Reinspection of Dam D-0933, J.W. Corley Pond Dam, Lexington County

Dear Mr. Krecker:

This office performed a routine inspection of the Bill Krecker Pond Dam (formerly J.W. Corley Pond Dam) on December 14, 2007. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620 or hauptmse@dhec.sc.gov

Sincerely,

Steve Hauptmann, EIT
District Engineer Associate
Region 3 EQC- Columbia

Enclosures

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 3

Serving Chester, Fairfield, Lancaster, Lexington, Newberry, Richland and York Counties

Columbia EQC Office • PO Box 156 • State Park, SC 29147 • Phone: (803) 896-0620 • Fax: (803) 896-0617 • www.scdhec.gov

INSPECTION REPORT

Date March 26, 2010

Dam D-0933, J.W. Corley Pond Dam, Lexington County

Representatives of SCDHEC Present:
John Poole, Peter Milenkov

Steve Hauptmann, Steve Bradley,

Representatives of Owner Present:

Bill Krecker

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

Recommend removal of Beaver/Otter population. Shrubs, bushes and trees should be removed especially within 20ft of the centerline if the discharge pipe.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*None

Emergency Action Plan Updated

Yes _____ No X

Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 20, 2003

Beaver Lake L.P.
5217 Trenholm Rd.
Columbia SC 29206

RE: Reinspection of Dam D-0574, Beaver Lake Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on Thursday, June 19, 2003 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-0574, Beaver Lake Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

William C. Cooper, P.E.

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated

Yes x No

Signature of Person Completing Form





Catherine B. Templeton, Director

Promoting and protecting the health of the public and the environment

April 1, 2013

Attn: John Bachaus

ANTHONY FAIRWAYS GENERAL PARTNERSHIP

C/O John Bachaus

P.O. BOX 290730

Columbia, SC 29229

RE: Inspection of West Lake Farms Dam D-4146, Classification C2, Richland County

Dear Mr. Bachaus:

This office performed an inspection of the referenced Class 2 Dam on Thursday March 30 2013. Enclosed you will find an inspection report which summarizes any comments or concerns.

Please understand that a reply is required from you. A plan of action must be submitted to this office within 15 days of receipt of this letter or enforcement actions will be taken. This could lead to fines and/or forced draining of the lake until the deficiencies are corrected.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to call me at (803) 896-0620 or e-mail me at hauptmse@dhec.sc.gov.

Sincerely,

Steven Hauptmann, EIT.
District Engineer Associate
Region 3, Columbia EQC Office



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5
State Park, SC 29147
(803) 935-7015 Fax (803) 935-6724

May 26, 2000

Heath Manning, Jr.
The Manning Company
1 Smallwood Circle
Columbia, SC 29223

RE: Reinspection of Dam D-0566, Duck Pond Lake Dam, Richland County

Dear Mr. Manning:

On Thursday, May 25, 2000, I conducted a routine reinspection of the above referenced dam. I am enclosing a copy of the inspection report on the dam. Any deficiencies are listed on the inspection report.

I have verified the telephone numbers on the Emergency Notification Plan and a copy is enclosed for your use. Should the dam experience difficulty, you should contact all of the numbers on the plan. The agencies listed on the plan can provide assistance in blocking roads and doing other things that need to be done in the event of an emergency.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us (SC DHEC) within thirty (30) days after transferring title or control of a dam to someone else. The notification must include the name, address and telephone number of the new owner. I am enclosing a blank form for your use in notifying us should control of your dam be transferred.

You will be notified when the next reinspection of this dam is scheduled.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date May 25, 2000

Dam D-0566, Duck Pond Lake Dam

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: None

Others Present: _____

List of noted deficiencies or items requiring correction/checking:

* All vegetation (brush, weeds, ect.), and small trees (less than 6" in diameter) should be cut and removed from the upstream slope of the dam.

NOTE: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

The above * were previously noted in April 1997

Emergency Action Plan Updated Yes No



Signature of Person Completing Form

DHEC 2604 (6/94)



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

December 29, 2005

Attn: Stewart Aleshire
PO Box 252469
Columbia, SC 29224

RE: Reinspection of Park Shore Lake Dam D-0562, Richland County

Dear Mr. Aleshire:

This office performed a routine inspection of the Park Shore Lake Dam on Thursday December 8, 2005. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to call me at (803) 896-0620 or e-mail me at mooneydl@dhec.sc.gov.

Sincerely,

Dwight L. Mooney Jr.
District Engineer Associate
Region 3, Columbia EQC Office

Enclosures

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 3

Serving Chester, Fairfield, Lancaster, Lexington, Newberry, Richland and York Counties

Columbia EQC Office • PO Box 156 • State Park, SC 29147 • Phone: (803) 896-0620 • Fax: (803) 896-0617 • www.scdhec.gov

INSPECTION REPORT

Date: Thursday December 8, 2005

Dam: D-0562, Park Shore Lake Dam, Richland County

Location: North Lake Drive Left on East Park Shore Right on Park Shore

Representatives of SCDHEC Present: Dwight Mooney, Sonya Johnson

Representatives of Owner Present: None

Others Present: Ray Robinson

List of noted deficiencies or items requiring correction/checking:

All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from the downstream slope of the dam. Keep drainpipe clear of vegetation.

Note: Dam should remain clear of vegetation year round.

Emergency Action Plan Updated Yes X No


Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 22, 2001

Mr. James K. Metze
1701 Old Tamah Rd.
Irmo, SC 29063

RE: Reinspection of Dam D-0540, James K. Metze Dam, Richland County

Dear Mr. Metze:

This office performed a routine inspection of the James K. Metze Dam on Thursday, June 21, 2001. The dam appears to be in fair condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendriek R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Thursday, June 21, 2001

Dam D-0540, James K. Metze Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: None

Others Present: None

List of noted deficiencies or items requiring correction/checking:

*Dam was too overgrown to do an inspection.

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*The above was also noted in 06/98

*Numerous trees on the embankment - 12/94

*Original spillway system appears to be blocked and not functioning - 12/94

Emergency Action Plan Updated

Yes _____ No



Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

February 8, 2005

Sandhill Research & Education Center
PO Box 23205
Columbia SC 29224

RE: Reinspection of Dam D-0553, Sandhill Research Center Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on November 16, 2004 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

A handwritten signature in black ink that reads 'Kendrick R. Chiles'.

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date November 16, 2004

Dam D-0553, Sandhill Research Center Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present:

Others Present: None

List of noted deficiencies or items requiring correction/checking:

* None

Note: Dam should remain clear of vegetation year round.


List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated

Yes No

Signature of Person Completing Form



DHEC 2604 (6/94)



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

January 2, 2008

Spring Valley Homeowners Association
Attn: Carl Voges
P.O. Box 25246
Columbia, SC 29224

Ref: D-0559 Lower Spring Valley Lake Dam, Richland County

Dear Sir,

On December 18, 2007 this office conducted a routine reinspection of the Lower Spring Valley Lake Dam. I am enclosing a copy of my inspection report. Several deficiencies have been noted which require your timely attention.

I am also enclosing a copy of the Emergency Notification and Surveillance Plan. Should your dam experience difficulties, you should immediately put the plan into action. Any buildings in low lying areas just below the dam should be evacuated. Any roads immediately downstream should be blocked on either side of the creek. The agencies listed on the plan could provide assistance in accomplishing this.

Provisions in the S.C. Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title to their dam to someone else. The notification must include the name and address of the new owner. We are enclosing a blank form for your use in notifying us should title to your dam be transferred.

Failure to respond to the above requests may result in referral of the matter to the enforcement division of the department for appropriate action.

If you have any questions at all please feel free to contact us at (803) 896-0620 or hauptmse@dhec.sc.gov

Sincerely,

Steve Hauptmann, EIT
District Engineer Associate
Region 3 EQC-Columbia

Enclosures

SOUTH CAROLINA DEPARTMENT OF HEALTH AND ENVIRONMENTAL CONTROL

Region 3

Serving Chester, Fairfield, Lancaster, Lexington, Newberry, Richland and York Counties

Columbia EQC Office • PO Box 156 • State Park, SC 29147 • Phone: (803) 896-0620 • Fax: (803) 896-0617 • www.scdhec.gov

INSPECTION REPORT

Date: December 18, 2007

Dam: D-0569, Lower Spring Valley Lake Dam, Richland County

Representatives of SCDHEC Present: Steve Hauptmann, Jessica McGougan

Representatives of Owner Present: None

Others Present: None


List of noted deficiencies or items requiring correction/checking:

Heavy vegetation present. All vegetation (brush, weeds, etc.), small trees (less than 6 inches in diameter) and fallen trees should be cut and removed from the dam. If larger trees are removed then holes should be filled and pack with clay and riprap placed where needed to prevent erosion. It is recommended that trees within 20 ft of the centerline of the outlet works pipe be removed. Before any tree 6" in diameter or greater is removed, an evaluation and removal plan should be sent to Steven Bradley for approval. No water flow from outlet structure at this time. **Holes on dam should be packed. Rotten stumps should be removed and packed. Recommend that all Beavers/Otters be removed from the dam area via trapping or other means.

Note: Dam should remain clear of vegetation year round.

Emergency Action Plan Updated Yes _____ No X

Signature of Person Completing Form

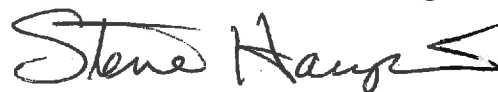



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

February 8, 2005

Elizabeth B. Davis
248 Killian Rd
Columbia SC 29203

RE: Reinspection of Dam D-0546, Stevenson's Lake Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on November 17, 2004 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date November 17, 2004

Dam D-0546, Stevenson's Lake Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present:

Others Present: None

List of noted deficiencies or items requiring correction/checking:

* None

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated Yes _____ No

Signature of Person Completing Form



DHEC 2604 (6/94)



Preliminary Inspection Report for South Carolina Regulated Dams and Impoundment Structures Regulations R.72-1 through R.72-9

Section I (Owner's Information)

A. Dam Number: D 0057 & Hazard Class C2
B. Name of Dam: Harbison New Town Lake
C. Inspection Date (06/20/14) & Time:
D. Date of Last Inspection: 09/17/2013
E. Location-County/City: Richland
F. EQC Regional Office: Region 3 -Columbia
G. Inspector's Name: Steven Hauptmann
H. Owner's Name: Harbison Comm. Association
I. Contact Person (if different from above): SCOTT LYNCH
J. Dam Owner's or Contact Person's Phone Numbers: Home () Office () Other ()
K. Dam Owner's or Contact Person's mailing address: Address 1 106 Hillpine Rd Address 2 (optional) City Cd9 State Zip Code 29212

Section II (Dam Condition)

General Condition Assessment (Select one of the following):

- a) Satisfactory [checked] b) Fair [] c) Poor [] d) Unsatisfactory [] e) Not Rated []

Section III (Dam Inspection Checklist)

A. Dam Crest

- i. Vegetation (grass, trees weeds)? Paved
ii. Animal activity observed? None
iii. Any obvious alteration or repairs made? None
iv. Erosion noticed on crest? NO
v. Any visible settlement, misalignment or cracks?

Section III (Dam Inspection Checklist) continued

B. Upstream Slope

- i. Vegetation (grass, trees weeds)? RIP RAP + GRASS
- ii. Animal activity observed? NO
- iii. Any obvious alterations or repairs made? _____
- iv. Erosion observed on upstream slope? _____
- v. Settlement or cracks visible in slope? Small DIPS / rain erosion

C. Down Stream Slope

- i. Vegetation (grass, trees weeds)? Concrete / Grass / trees / brush
- ii. Animal activity observed? _____
- iii. Any obvious alterations or repairs made? _____
- iv. Erosion observed on down stream slope? _____
- v. Settlement or cracks visible in slope? _____
- vi. Toe drains flowing? _____
- vii. Any seepage observed? If so, describe location, flow rate, and any turbidity or color within the flow: _____

D. Primary Spillway

- i. Any visible deterioration of structure? NO
- ii. Is there an obvious need to repair or replace trash rack? NO - clean
- iii. Any noticeable problems with debris? NONE
- iv. Is valve or gate present? _____

E. Outlet Pipe

- i. Any water visibly flowing or leaking outside of the discharge pipe? NO
- ii. Describe any deflection or damage observed to the pipe: /
- iii. Visible condition of outlet channel: Normal

F. Auxiliary (Emergency) Spillway

- i. Noticeable obstructions to flow? _____
- ii. Animal activity observed? _____
- iii. Any noticeable deterioration in the approach or discharge channel? _____
- iv. Any visible deterioration of structure's crest? _____

F. Auxiliary (Emergency) Spillway continued

v. If applicable, any observed exposure of rebar reinforcement? _____

vi. If applicable, any visible leakage below concrete spillway? _____

H. Downstream/Hazard Class Issues

i. Any noticeable changes immediately downstream of the dam that affects the hazard classification? _____

NO recent changes

I. Emergency Action Plan (EAP)

i. Emergency Action Plan provided by owner? _____

ii. Does EAP contains emergency alert notification plan? If so, when was it last updated? _____

iii. Does EAP contain specific actions to take if the dam has failed or is near failure? _____

Section IV (Conclusions)


General comments and recommendations:

Woodcross Dc. Dam -

- trees on down stream slope should be evaluated for removal as normal maintenance.*
- trees within 20 ft of outlet structure should take priority in tree removal plan.*
- brush/weeds should be clear of slope to facilitate inspection of slope.*
- upstream areas base dirt should have grass cover to reduce soil erosion.*

Preliminary Dam Inspection Disclaimer:

The information contained in the preliminary inspection report is intended as an aid to identify those dams that require maintenance and/or repair actions to reduce their danger to human life or property only. It is not intended as professional engineering or consulting advice for conditions or situations present at individual dams. It is not a substitute for a detailed inspection, nor does it replace the need for services provided by registered professional engineers. If your dam is experiencing an unusual situation consult with engineering professionals to find an appropriate remedy. Preliminary inspections conducted by South Carolina Department of Health and Environmental Control (the Department) are provided "AS IS" and "as available", without warranties of any kind, either express or implied. Preliminary inspections consist only of a visual but technical examination of the dam and its appurtenant works. All findings are based solely on visual observations of the inspector at the time of the inspection. Common law holds that the storage of water is a hazardous activity and the Department does not assume any responsibility or risk for your actions or inactions. Dam owners are responsible for the safe operations and maintenance of their impoundment structures.

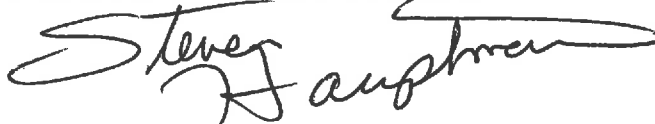


COMMISSION MEMBERS:

WILLIAM S. SIMPSON III
Chairman
813 Robert E. Lee Blvd.
James Island, S.C. 29412

DAVID L. ALLEN
P.O. Box 414
Hartsville, S.C. 29550

O. RICHARD COTHRAN, JR.
441 Griffin Drive
Piedmont, S.C. 29673

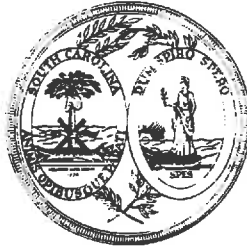

State of South Carolina

PRESTON B. HERLONG
Route 1, Box 297
Johnston, S.C. 29832

C.P. MINCEY
Route 2, Box 152
Mullins, S.C. 29574

JOHN W. PARRIS
Executive Director

**LAND RESOURCES
CONSERVATION COMMISSION**

May 14, 1991

The Harbison Group
P. O. Box 21368
Columbia, S.C. 29221

Re: Floodwater Detention Structure, State Dam No. 40-D4139, located approximately 2000 feet upstream from State Secondary Road S-40-1280 (Piney Grove Road) on Stoop Creek, northwest of Columbia, S.C.

Dear Sirs:

In accordance with the South Carolina Dams and Reservoirs Safety Act, the Land Resources Commission has inventoried all dams subject to the Act. The inventory identifies certain dams that come under the provisions of the Act due to their size and location.

The above referenced dam has been identified as being in this category and a visual reinspection has been made.

This inspection was done to determine the present condition of the dam and note any changes that may have occurred since the last inspection.

The findings of the inspection are as follow:

1. The dam is considered to be a Class II structure (significant downstream hazard potential) due to probable damage to downstream property in the event of failure.
2. The dam is in essentially the same condition as at the time of the last inspection.

The Harbison Group
May 14, 1991
Page 2

3. There are trees and brush on the upstream and downstream slopes.
4. Trash and debris continue to block the inlet end of the concrete pipe through the dam. This trash should be removed immediately and some type of trash guard placed upstream to prevent future blockage.

We suggest that you establish a routine maintenance program for the dam. This should include removing brush and small trees from the dam, repairing any areas of erosion that develop, maintaining a good cover of grass on the slopes and keeping the spillway system free from obstructions and in good operating condition. Please include periodic inspections of the dam and inform this office of any significant changes or problems which may affect the safety of the dam.

Any alteration or major repairs of the dam require a permit from this agency and must be made under the direction of a qualified engineer.

We are enclosing two copies of our emergency notification and surveillance plan.

We request that you complete both copies and return one copy for our files.

If you have any questions, please call.

Sincerely,



Rick Nuzum, P.E.
Regional Engineer
Dams and Reservoirs Safety Program

enclosures



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147

May 15, 1997

SC Mental Health Commission
Wade Hampton Office Building
Columbia, SC 29202

RE: D-0551
Manning Correctional Dam
Richland County

To Whom it May Concern:

On May 14, 1997 I conducted a routine reclassification check of your dam. I am enclosing a copy of my inspection report. The purpose of the inspection was to determine if the dam should be reclassified. Your dam is a Class 3, or low hazard. I am requesting that your dam be reclassified to a Class 2, or significant hazard. The reason for this reclass is because of a recently constructed building located directly below the dam. If your dam would have a failure, this building may suffer significant property damage.

Kendrick Chiles from this office will accompany me on another inspection of your structure to upgrade the classification, then he will contact you to set up a thorough inspection of the dam. Class 2 dams are inspected every three years. Should there be deficiencies found, they must be corrected in a timely manner, or you could face potential monetary fines from the Department.

If you have any questions, please feel free to call me or Mr. Chiles at (803) 935-7015.

Sincerely,

Kristine C. Hoskins
Central Midlands EQC District

cc: Kendrick Chiles, Central Midlands EQC District

Class 3
Low Hazard Dam Classification Check

Dam Number D 0551

County Richland

Tax Map No. _____

Has Ownership Changed? _____ yes no

If yes, new owner and address SC Mental Health Commission
(Record any address change, even if same owner.)

Is there any evidence of new development below the dam?
 yes _____ no

If yes, do you think the classification should be upgraded?
 yes _____ no

What is your opinion of what the new classification should be?
_____ Class I (High Hazard)

Class II (Significant Hazard)

Kristine Coffey
Signature and Date

Recheck by District Engineer

_____ Leave as low hazard.

_____ Reclassify to high hazard. (Schedule for inspection.)

Reclassify to significant hazard. (Schedule for inspection.)

Kendrick R. Chle

5/22/97

District Engineer's Signature and Date



Preliminary Inspection Report for South Carolina Regulated Dams and Impoundment Structures Regulations R.72-1 through R.72-9

Section I (Owner's Information)

A. Dam Number: D 0620 & Hazard Class C2 D-0020 B. Name of Dam: Big Coldstream Dam
C. Inspection Date (8/21/2015) & Time: D. Date of Last Inspection:
E. Location-County/City: Lex F. EQC Regional Office: Region 3 -Columbia
G. Inspector's Name: Steven Hauptmann
H. Owner's Name:
I. Contact Person (if different from above):
J. Dam Owner's or Contact Person's Phone Numbers: Home Office Other
K. Dam Owner's or Contact Person's mailing address: Address 1 Address 2 (optional) City State Zip Code

Section II (Dam Condition)

General Condition Assessment (Select one of the following):

- a) Satisfactory b) Fair c) Poor d) Unsatisfactory e) Not Rated

Section III (Dam Inspection Checklist)

A. Dam Crest

- i. Vegetation (grass, trees weeds)? grass
ii. Animal activity observed?
iii. Any obvious alteration or repairs made?
iv. Erosion noticed on crest?
v. Any visible settlement, misalignment or cracks?

Section III (Dam Inspection Checklist) continued

B. Upstream Slope

- i. Vegetation (grass, trees weeds)? straight slopes in some areas
- ii. Animal activity observed? _____
- iii. Any obvious alterations or repairs made? _____
- iv. Erosion observed on upstream slope? Wave erosion, steep slopes
- v. Settlement or cracks visible in slope? _____

C. Down Stream Slope

- i. Vegetation (grass, trees weeds)? no many trees, brush, briars, stumps
- ii. Animal activity observed? _____
- iii. Any obvious alterations or repairs made? _____
- iv. Erosion observed on down stream slope? steep slopes
- v. Settlement or cracks visible in slope? _____
- vi. Toe drains flowing? _____
- vii. Any seepage observed? If so, describe location, flow rate, and any turbidity or color within the flow: _____

D. Primary Spillway

- i. Any visible deterioration of structure? _____
- ii. Is there an obvious need to repair or replace trash rack? _____
- iii. Any noticeable problems with debris? _____
- iv. Is valve or gate present? _____

E. Outlet Pipe

- i. Any water visibly flowing or leaking outside of the discharge pipe? _____
- ii. Describe any deflection or damage observed to the pipe: _____
- iii. Visible condition of outlet channel: _____

F. Auxiliary (Emergency) Spillway

- i. Noticeable obstructions to flow? _____
- ii. Animal activity observed? _____
- iii. Any noticeable deterioration in the approach or discharge channel? _____
- iv. Any visible deterioration of structure's crest? _____

F. Auxiliary (Emergency) Spillway continued

v. If applicable, any observed exposure of rebar reinforcement? _____

vi. If applicable, any visible leakage below concrete spillway? _____

H. Downstream/Hazard Class Issues

i. Any noticeable changes immediately downstream of the dam that affects the hazard classification? _____

I. Emergency Action Plan (EAP)

i. Emergency Action Plan provided by owner? _____

ii. Does EAP contains emergency alert notification plan? If so, when was it last updated? _____

iii. Does EAP contain specific actions to take if the dam has failed or is near failure? _____

Section IV (Conclusions)

General comments and recommendations:

Preliminary Dam Inspection Disclaimer:

The information contained in the preliminary inspection report is intended as an aid to identify those dams that require maintenance and/or repair actions to reduce their danger to human life or property only. It is not intended as professional engineering or consulting advice for conditions or situations present at individual dams. It is not a substitute for a detailed inspection, nor does it replace the need for services provided by registered professional engineers. If your dam is experiencing an unusual situation consult with engineering professionals to find an appropriate remedy. Preliminary inspections conducted by South Carolina Department of Health and Environmental Control (the Department) are provided "AS IS" and "as available", without warranties of any kind, either express or implied. Preliminary inspections consist only of a visual but technical examination of the dam and its appurtenant works. All findings are based solely on visual observations of the inspector at the time of the inspection. Common law holds that the storage of water is a hazardous activity and the Department does not assume any responsibility or risk for your actions or inactions. Dam owners are responsible for the safe operations and maintenance of their impoundment structures.



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 28, 2001

Mallard Lakes Pond #3 HOA
Attn: Mr. Michael W. Tighe
P.O. Box 1390
Columbia, SC 29202

RE: Reinspection of Dam D-4095, Mallard Lakes Dam, Lexington County

Dear Mr. Tighe:

This office performed a routine inspection of the Mallard Lakes Dam on Tuesday, June 26, 2001. The dam appears to be in good condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Tuesday, June 26, 2001

Dam D-4095, Mallard Lakes Dam, Lexington County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present: None

Others Present: None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated Yes _____ No _____



Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617
June 20, 2003

Columbia Golf Properties LLC
c/o Mr. Ron Stevenson
7629 Fairfield Rd.
Columbia SC 29203

RE: Reinspection of Dam D-0543, Oak Hills Golf Club Dam , Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on Thursday, June 19, 2003. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-0543, Oak Hills Golf Club Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

Richard Williams

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:


*

Emergency Action Plan Updated

Yes x No

DHEC 2604 (6/94)

Signature of Person Completing Form

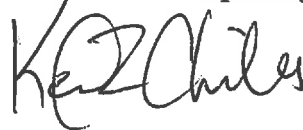



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 28, 2001

Averyt Family Blythewood Limited Partnership
c/o Gayle O. Averyt
P.O. Box 1365
Columbia, SC 29202

RE: Reinspection of Dam D-0530, Averyt Family Dam #1, Fairfield County

Dear Mr. Averyt:

This office performed a routine inspection of the Averyt Family Dam #1 on Wednesday, June 27, 2001. The dam appears to be in good condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Wednesday, June 27, 2001

Dam D-0530, Averyt Family Dam #1, Fairfield County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

Gene Scaoefield

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*None

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*None

Emergency Action Plan Updated

Yes No



Signature of Person Completing Form

DHEC 2604 (6/94)



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 28, 2001

Town of Winnsboro
Attn: Ronnie McDaniel
P.O. Box 209
Winnsboro, SC 29180

RE: Reinspection of Dam D-0523, Jackson/Mill Creek WCD Dam #7, Fairfield County

Dear Mr. McDaniel:

This office performed a routine inspection of the Jackson/Mill Creek WCD Dam #7 on Wednesday, June 27, 2001. The dam appears to be in fair condition. Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again next year. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

cc: Richard Yongue, DHEC Bureau of Water Facilities Compliance

INSPECTION REPORT

Date Wednesday, June 27, 2001

Dam D-0523, Jackson/Mill Creek WCD Dam #7, Fairfield County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

Representative for Town
of Winnsboro

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated

Yes No



Signature of Person Completing Form



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 20, 2003

DJC Family United Partnership
Attn: Matthew Condgon
475 Killian Rd
Columbia SC 29203

RE: Reinspection of Dam D-0362, IBM (Epworth Pines) Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on Thursday, June 19, 2003 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-0362, IBM (Epworth Pines) Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

None

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated

Yes x No

Signature of Person Completing Form



DHEC 2604 (6/94)



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

June 20, 2003

Cedar Lake Landowners
c/o John Billings
315 Mt. Valley Rd.
Columbia SC 29016

RE: Reinspection of Dam D-0293, Cedar Lake Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on Thursday, June 19, 2003 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date June 19, 2003

Dam D-0293, Cedar Lake Dam, Richland County

Representatives of SCDHEC Present:

Kendrick R. Chiles

Representatives of Owner Present:

Mike Burr

Others Present:

None

List of noted deficiencies or items requiring correction/checking:

*All dead trees should be removed from the dam.

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated

Yes No

DHEC 2604 (6/94)

Signature of Person Completing Form

K. R. Chiles



CENTRAL MIDLANDS EQC DISTRICT

PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

February 8, 2005

Second Wind Farms
236 Persimmon Fork Rd
Blythewood SC 29016

RE: Reinspection of Dam D-0279, Mullers Lake Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on November 17, 2004 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date November 17, 2004

Dam D-0279, Mullers Lake Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present:

Others Present: None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.


Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated Yes _____ No

Signature of Person Completing Form

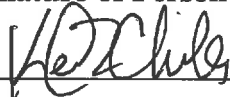

DHEC 2604 (6/94)

BOARD:
Elizabeth M. Hagood
Chairman
Mark B. Kent
Vice Chairman
Howard L. Brilliant, MD
Secretary



C. Earl Hunter, Commissioner

Promoting and protecting the health of the public and the environment.

BOARD:
Carl L. Brazell
Louisiana W. Wright
L. Michael Blackmon
Coleman F. Buckhouse, MD

Dams and Reservoirs Safety
Bureau of Water

February 3, 2005

Deerlake, LLC
C/o John Stephenson, P.E.
Power Engineering
138 West Park Boulevard
Columbia, South Carolina 29210

Re: Deerlake Dam, D-0137, Richland County, South Carolina

Dear Sir or Madam:

The referenced dam has been cleared. We thank you for your attention in regards to this matter.

The dam still may require some additional measures to improve the stability of the dam. The principle spillway pipe, for example, may be rusted such that outflow is seeping through to the embankment. The concrete emergency spillway is also cracked. A "Dams and Reservoirs Safety Permit" Application and design plans must be submitted for approval prior to constructing the additional repairs.

We regulate dams that are 25' high or potentially impound more than 50 acre-feet in volume. Other smaller dams are regulated if the failure of the dam would inundate the living space of a residence to a depth of one foot.

If your dam does not meet the requirements for regulation, you may petition for the dam to be removed from our inventory.

If you have any questions or comments, I may be reached at (803) 898-4027.

Sincerely,

Steven M. Bradley, P.E.
Dams and Reservoirs Safety

Cc: Mr. Kendrick Chiles, Central Midlands

RECEIVED

FEB 04 2005

**CENTRAL MIDLANDS
DISTRICT - EQC**

MEMORANDUM

To: File

From: Kendrick R. Chiles

Subject: Deerlake Dam, D-0137, Richland County

Date: June 28, 2001

Could not find a responsible party for this dam. Vegetation around dam is heavy and access to dam is blocked. Was not able to do an inspection.



CENTRAL MIDLANDS EQC DISTRICT
PO Box 156, Building #5
State Park, SC 29147
(803) 896-0620 Fax (803) 896-0617

February 8, 2005

Wilmont B. Irvin
2930 McCords Ferry Rd
Eastover SC 29044

RE: Reinspection of Dam D-0116, Double Eye Dam, Richland County

Dear Sir or Madam::

This office performed a routine inspection of the above referenced dam on November 18, 2004 . Enclosed you will find an inspection report which summarizes any comments or concerns.

Also enclosed is a copy of the Emergency Notification and Surveillance Plan. Please keep this in an easily accessible location so that all agencies can be notified as quickly as possible should the dam ever experience difficulty. Should the person responsible for implementing the plan change, our office must be notified immediately.

Provisions in the SC Dams and Reservoirs Safety Act require the owner to notify us within 30 days after transferring title or control of a dam to someone else. Enclosed is a form for your use should this transfer be necessary. Please note that this notification must include the name and address of any new owner.

This dam will be inspected again in three years. If you need any assistance or have any questions prior to the next inspection, please do not hesitate to contact us at (803) 896-0620.

Sincerely,

Kendrick R. Chiles
District Engineer Associate
Central Midlands EQC District Office

Enclosures

INSPECTION REPORT

Date November 18, 2004

Dam D-0116, Double Eye Dam, Richland County

Representatives of SCDHEC Present: Kendrick R. Chiles

Representatives of Owner Present:

Others Present: None

List of noted deficiencies or items requiring correction/checking:

*All vegetation (brush, weeds, ect.) and small trees (less than 6 inches in diameter) should be cut and removed from dam.

Note: Dam should remain clear of vegetation year round.

List of previously noted items still uncorrected and dates previously noted:

*

Emergency Action Plan Updated Yes _____ No

Signature of Person Completing Form